



Autocar Engineering 350 West Deerfield Road Union City, Indiana 47390-1039

tel:

765-964-3121 ext 242

fax:

765-964-3254

email: sgornick@autocartruck.com

RECEIVED

7003 FEB - b P 2: 01

OFFICE OF DEFECTS

January 29, 2003

Associate Administrator for Enforcement National Highway Traffic Safety Administration 400 Seventh Street, S.W. Washington, DC 20590

03V-020 Oa®

The following information is submitted in accordance with the requirements of 49 CFR Part 573.5 as it applies to a defect relating to motor vehicle safety.

573.5(c)(1) Autocar, LLC 350 Deerfield Road Union City, Indiana 47390-1039

573.5(c)(2)

Certain Autocar WX, WXLL, and WXR model, heavy-duty class 8 vehicles assembled by Volvo Trucks North America, Inc. between May 3, 2002; and August 23, 2002.

The vehicles affected by this notification were selected by using the part numbers of the two suspect axie seats and the time period that the suspect axie seats were used in production.

573.5(c)(3)

Thirty-two (32) vehicles potentially contain the suspect defect.

573.5(c)(4)

Percentage of vehicles expected to contain the suspect defect is unknown.

573.5(c)(5)

The forward and/or rear drive axie upper axie seat may break potentially allowing the affected axie to shift out of alignment. This condition could result in loss of axie stability and potential for vehicle crash.

NHTSA Page Two January 29, 2003

10-13-02

11-20-02

573.5 (c)(6)

	to the rear drive axle the axle seat broke when the u-bolts, which attach the seat to the suspension, were tightened.
11-7-02	Results of vendor analysis indicated that the suspect upper axle seat was not within material specification. A review of the vendor's records identified three date codes, which were affected.
11-14-02	No reports of failures have been reported on vehicles in the field (service).
11-1 9- 02	Volvo Trucks North America, Inc. decided that such condition constitutes a defect and that such condition is safety-related.

Quality personnel reported that during installation of an upper axie seat.

Volvo Trucks North America, Inc. informed Autocar that they would be performing the recall on the trucks assembled in their facility and would

1-28-03 Volvo Trucks North America, Inc. Informed Autocar that due to difficulties processing the recall claims for Autocar product through their warranty system they decided that Autocar should process the recall claims on their own Warranty Claim System.

573.5(c)(7) Not applicable

573.5(c)(8)

Autocar, LLC, will initiate a voluntary recall of all 32 vehicles which could contain the suspect forward drive axie or rear drive axie seats.

The recall will consist of the replacement of the upper axle seat on both rear drive axles.

The number, which has been assigned to this recall by Autocar, LLC. is A - 0301

do all the necessary paperwork.

Volvo Trucks North America Informed both Autocar and Volvo owners and dealerships concurrently of their recall, however, when the recall claims started to come in from the Volvo dealerships problems arose when the Volvo Recall System rejected any VINs assigned by Autocar. To remedy this situation Volvo decided to assign the Autocar portion of the recall over to Autocar. Autocar is planning on notifying the dealerships to file Autocar recall claims through the Autocar Warranty system instead of Volvo's but will leave the rest

NHTSA Page Three January 29, 2003

of the paperwork as distributed by Volvo. Autocar feels that sending out new Bulletins and Owner Letters will only confuse the situation. Recall parts will still be purchased through Volvo Parts and the time allowances will remain unchanged so the only difference to the dealership is what computer system the claim is filed on.

If you have any concerns with the direction we are taking on this recall please contact the undersigned.

Very Truly Yours

AUTOCAR, LLC

Stan R. Gornick, P. Eng.

Manager, Compliance & Engineering Quality